

**CHINESE PETROLEUM CORPORATION
M/T'YU TSAO II' 2008 DOCKING
DAILY & MAINTENANCE REPORT**

DATE : 2008/12/19-20

甲板追加工作如附件，已經請船廠報價中（AWO5-9.doc, AWO-10-15.doc）。

鍋爐爐管切除工作已接近完成，爐管管路也已經完成，等細部修整管口後即可開始安裝新爐管，鍋爐議價於 19 日下午五點完成議價手續，議價價格為新加坡幣 146740 元，相關之決標記錄及驗收通知單已經於議價完成後 EMAIL 回辦公室進行陳核。

CARGO PUMP, BALLAST PUMP, TURBINE FOR SHAFT GENERATOR, CARGO PUMP & BALLAST PUMP 均已經開始施工。

BRIDGE WING 除銹開始施工，航行燈座切除，準備更新。

駕駛台兩邊底下結構除銹油漆今天檢查未通過，No.1P 檢查也沒有通過，新加坡政府規定船廠每月之第一及第三個星期星期天不得有太多人加班，所以目前船廠晚上不加班，假日有時也不加班，進度時在很難掌空，希望能夠如期開船，進塢時間可能會延後至 27 日。

安排船上人員至 **SINCO AUTOMATION** 參加由該公司之技術工程師講解有關 **P/R GAS DETECTOR** 及 **ODME** 保養校正之課程，讓船上能夠有足夠知識可以自行保養及校正該等設備，參加之人員計有輪機長、二管、電機師、大副、二副、三副及葉兄。

PV BREAKER 檢查油漆前噴砂，發現有破洞，將安排修理後再油漆。

➤ **保養報告/Deck. Dept.** 監修工程 船長 李德修、大副 黃炳榮

2008/12/19

1. 貨油艙蓋油漆
2. 貨油艙及水艙的人孔蓋除銹
3. 糧食吊車的柱子油漆

2008/12/20

1. 船艙左錨機除銹
2. 將主甲板 3C 走道銹蝕的腳踏板拆除,且將四周圍的框架除銹,除銹後發現框架已不堪使用,要報修
3. **IG SCRUBBER** 內部的橡膠有些已受損,經處理後再用 **PUTTY** 修補
4. 到 **SINCO** 工廠參觀,了解要新裝上船的泵間氣體偵測器使用方法,及 **ODM** 操作程序

➤ **保養報告/Mach. Dept.** 監修工程 輪機長 胡榮洲、大管輪 袁建華

2008/12/19

1. 高溫冷卻水 NO.2 冷卻器板片繼續刷洗.
2. 低溫冷卻水 NO.1 冷卻器板片繼續刷洗.
3. M/E 汽缸油注油器拆檢清潔及更換內外之"o"-ring 繼續執行.
4. **IG** 沖洗水塔海水管線堵塞,拆檢清通共三段(16M).(高空危險作業)
5. NO.1 主海水泵上方海水管(65A)堵塞共 2 段(8.5M)拆檢清通後裝回.(高空危險作業)
6. M/E L.O.SUMP TANK 之滑油駁送至 M/E L.O. SETTING TANK.

**CHINESE PETROLEUM CORPORATION
M/T"YU TSAO II" 2008 DOCKING
DAILY & MAINTENANCE REPORT**

DATE : 2008/12/19-20

7. 準備排氣閥配件一組,伺機交與"AZUMA"..

2008/12/20

1. 高溫冷卻水 NO.2 冷卻器板片繼續刷洗.
2. 低溫冷卻水 NO.1 冷卻器板片繼續刷洗.
3. M/E 汽缸油注油器拆檢清潔及更換內外之"o"-ring 繼續執行.
4. IG 沖洗水塔內濾網以化學藥水沖洗,海水管線連通到機艙堵塞,拆檢清通.
5. M/E L.O.SUMP TANK 之滑油駁送至 M/E L.O. SETTING TANK 完成.
6. M/E L.O. SUMP TANK 之人孔蓋打開待檢查清潔.
7. 鍋爐蒸汽管線 16K~9K 之安全閥拆卸..

台灣中油股份有限公司 儲運處

監修工程 黃戊辰工程師、葉仁富



Cutting of the top side furnace wall tube



Cutting of the bottom side furnace wall tube



water drum for boiler furnace wall tube



Furnace for boiler

CHINESE PETROLEUM CORPORATION M/T "YU TSAO II" 2008 DOCKING DAILY & MAINTENANCE REPORT

DATE : 2008/12/19-20



CARGO PUMP TURBINE SIDE



CARGO PUMP 減速齒輪



Turbine Generator



Rotor for T/G




Rotor for Cargo pump



Condenser for T/G

CHINESE PETROLEUM CORPORATION M/T "YU TSAO II" 2008 DOCKING DAILY & MAINTENANCE REPORT

DATE : 2008/12/19-20

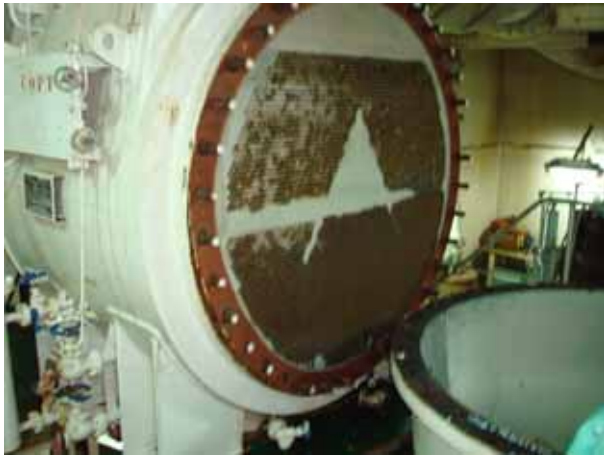

Condenser for T/G



cable pipe double plate for penetrate P/R



P/R gas detector training by Sinco



ODME training by Sinco



PV Breaker blasting & found hole



PV BREAKER

**CHINESE PETROLEUM CORPORATION
M/T"YU TSAO II" 2008 DOCKING
DAILY & MAINTENANCE REPORT**

DATE : 2008/12/19-20



Navigation light cutting for renewal



Bridge wing under side



Junction box for cable line



Expansion joint renewal for cargo line



Hatch cover for ballast tank



Staging for radar mast